

FLOOR PLAN NOTES

- 1

REMOVE AND RELOCATE EXISTING FAN POWERED BOX. REMOVE ASSOCIATED BRANCH DUCTWORK AS INDICATED. REMOVE EXISTING TAKE-OFF AND PATCH/INSULATE MAIN IF NOT REUSED FOR NEW WORK.
- 2

RELOCATED FAN POWERED BOX. REBALANCE TO CFM INDICATED. VERIFY PROPER OPERATION UPON REINSTALLATION.
- 3

INSTALL EXISTING THERMOSTAT ON WALL. EXTEND CONTROL WIRING AS NECESSARY TO RECONNECT TO ASSOCIATED NEW/RELOCATED FAN POWERED BOX.
- 4

PROVIDE NEW THERMOSTAT TO MATCH BUILDING STANDARDS. CONNECT TO NEW FAN POWERED/VAV BOX.
- 5

PROVIDE NEW MEDIUM PRESSURE TAKE-OFF ON EXISTING MAIN DUCT. RE: DETAIL.
- 6

PROVIDE GRILLE WITH RETURN AIR BOOT. RE: DETAIL.
- 7

INSTALL BOTTOM OF WALL GRILLE AT 8' AFF.
- 8

INSTALL SLOT DIFFUSER AS CLOSE TO EXTERIOR WALL AS POSSIBLE TO AVOID CONFLICT WITH METAL STUD KICKERS. MAINTAIN CONSISTENCY THROUGHOUT FLOOR.

Ascend Learning


Tenant Improvement

11161 Overbrook Road  
Leawood, Kansas

Two Hallbrook Place

ISSUED FOR:

Pricing Documents 20 December 2011

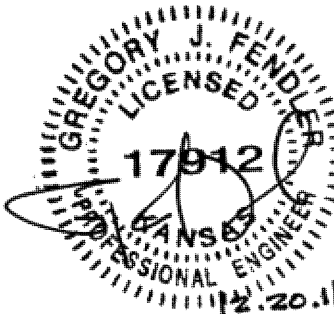

Gastinger  
Walker  
Harden  
Architects

817 Wyndotte  
Kansas City, MO 64105  
816 421 8200 p  
816 421 1262 f  
www.gwhm.com

Structural Engineer  
BSE Structural Engineers, LLC  
9911 Plumm Road  
Lenexa, KS 66215  
913-492-7400

Mechanical/Electrical/Plumbing Engineer  
Lankford + Associates Consulting Engineers, Inc.  
1730 Walnut Street  
Kansas City, MO 64108  
816-221-1411

 **Lankford**  
+ associates  
Consulting Engineers, Inc.

1730 Walnut Street Kansas City, Missouri 64108 816.221.1411  
Fax: 816.221.1429  
COPYRIGHT © 2011 LANKFORD + ASSOCIATES, INC.  
L+A Project No. 4042

KEY PLAN

Drawn By RMF, JDB, SMP  
Checked By GJF

4TH FLOOR PLAN  
SOUTH-MECHANICAL

80.05

Project Number: 2011.250 © Copyright 2011

4TH FLOOR PLAN SOUTH-MECHANICAL

SCALE: 1/8"=1'-0"



DWG FILE: P:\000\4042 Ascend Learning\Drawings\4042\80.05 80.05.dwg USER: David PLOT DATE/TIME: 12/20/2011 4:32pm