

FLOOR PLAN NOTES

- 1 REMOVE AND RELOCATE EXISTING FAN POWERED BOX. REMOVE ASSOCIATED BRANCH DUCTWORK AS INDICATED. REMOVE EXISTING TAKE-OFF AND PATCH/INSULATE MAIN IF NOT REUSED FOR NEW WORK.
- 2 RELOCATED FAN POWERED BOX. REBALANCE TO CFM INDICATED. VERIFY PROPER OPERATION UPON REINSTALLATION.
- 3 INSTALL EXISTING THERMOSTAT ON WALL. EXTEND CONTROL WIRING AS NECESSARY TO RECONNECT TO ASSOCIATED NEW/RELOCATED FAN POWERED BOX.
- 4 PROVIDE NEW THERMOSTAT TO MATCH BUILDING STANDARDS. CONNECT TO NEW FAN POWERED/NAV BOX.
- 5 PROVIDE NEW MEDIUM PRESSURE TAKE-OFF ON EXISTING MAIN DUCT. RE: DETAIL.
- 6 PROVIDE GRILLE WITH RETURN AIR BOOT. RE: DETAIL.
- 7 INSTALL BOTTOM OF WALL GRILLE AT 8" AFF.
- 8 INSTALL CONDENSING UNIT ON ROOF CURB PER DETAIL. LOCATE UNIT WITHIN ROOF SCREEN. COORDINATE ROOF CURB INSTALLATION WITH EXISTING ROOFING CONTRACTOR AS TO MAINTAIN CURRENT ROOF WARRANTY.
- 9 ROUTE REFRIGERANT PIPING DOWN THRU FLOOR WITHIN EXISTING ELECTRICAL ROOM TO FIRST FLOOR. PROVIDE TRAPS IN REFRIGERANT PIPING AS REQUIRED PER MANUFACTURERS RECOMMENDATIONS.
- 10 INSTALL SLOT DIFFUSER AS CLOSE TO EXTERIOR WALL AS POSSIBLE TO AVOID CONFLICT WITH METAL STUD KICKERS. MAINTAIN CONSISTENCY THROUGHOUT FLOOR.

Ascend Learning


Tenant Improvement

11161 Overbrook Road
Leawood, Kansas

Two Hallbrook Place

ISSUED FOR:

Pricing Documents 20 December 2011

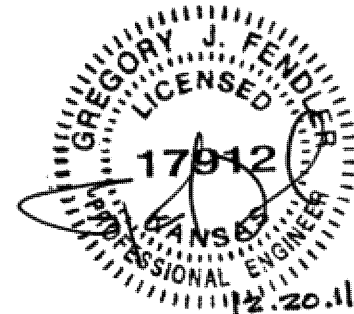

Gastinger
Walker
Harden
Architects

817 Wyndotte
Kansas City, MO 64105
816 421 8200 p
816 421 1262 f
www.gwhm.com

Structural Engineer
BSE Structural Engineers, LLC
9911 Plumm Road
Lenexa, KS 66215
913-492-7400

Mechanical/Electrical/Plumbing Engineer
Lankford + Associates Consulting Engineers, Inc.
1730 Walnut Street
Kansas City, MO 64108
816-221-1411



1730 Walnut Street Kansas City, Missouri 64108 816.221.1411
Fax: 816.221.1429
Copyright © 2011 LANKFORD + ASSOCIATES, INC.
L+A Project No. 4042

KEY PLAN

Drawn By RMF, JDB, SMP
Checked By GJF

4TH FLOOR PLAN
NORTH-MECHANICAL

80.06

Project Number: 2011.250

© Copyright 2011